

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No.41 DATE: 20/03/2000

SUBJECT: CP29ST2/3 PURITY PROBLEM

FAULT: Coloured patches around the screen. Degaussing the set with a hand held degaussing wand fixes the fault, but after a few days, it reappears.

CAUSE: Posistor **PS601** is not delivering enough current to degauss the picture tube.

REMEDY: Replace the **PS601** posistor with a new "stronger" type.

Part Number: 408 000 4309

