

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 42 DATE: 26/04/2000

SUBJECT: PLC-9000EA Ghosting

Fault: After long continuous use some units may develop a ghost image left of menu bars or characters. Also a vertical line may appear on the right hand edge of the screen.

Cause: Some panels may cause a slight delay of the clock phase, which shows up as the above-mentioned ghost.

Remedy: Put the unit in "Service Mode" as described in the Service Manual and adjust "Data No. 13" from "0006" to "0005".

Affected Units: Units with serial numbers between **G8901001** and **G9101330** are effected.