

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 46 DATE: 3/1/01

SUBJECT: CDP-1100 & CDP-4100 Not Charging

Fault: Customer's report that the supplied nickel cadmium battery model number NBP-50A does not charge.

Cause: Despite, a good description, in the Instruction Manual and arrow markings on the battery, the customer inserts the battery upside down. While the polarity is correct, the Charge-sensor terminal does not make contact with the battery body, which disables the charging circuitry.

Remedy: Insert the battery, so that one of the Arrows points toward the Headphone socket and other toward the Lid of the battery compartment. Make sure that the metal body of the battery is in contact with the charge-sensor terminal. See the diagram below.

