

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 49

DATE: 22/1/02

SUBJECT: EMX471 DOOR LATCH

Fault: Mains Fuse (Part No. 423 022 7503) blows.

Cause: The Door Latch (Part No. 617 179 2478) is too short and can not activate the Interlock Monitor Switch (Part No. 617 221 4061), which remains closed and shorts the Mains Fuse out.

Remedy: Replace all three (3) parts and check the Primary Interlock Switch. These parts (Mains Fuse, Door Latch and Interlock Monitor Switch) are available as a kit, Part No. EMX471MK. For the locations of these part and other service information please refer to the Supplement Service Manual Part No. WMSS860264 pages 6 and 7.