

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 62

DATE: 15/12/03

SUBJECT: CP21AF1V

Fault: Switches to “Stand by” intermittently.

Cause: Loss of synchronisation between “Hold-down” and “Stand-by” circuit.

Remedy: Replace R449 10K ohm surface mount resistor to 1.8K ohm.

Effected: All units with a serial number less then 13810101.

Method: If surface mount resistor is not available, a 1.8K ohm 1/6W resistor can be used. See Fig. 1 Below.

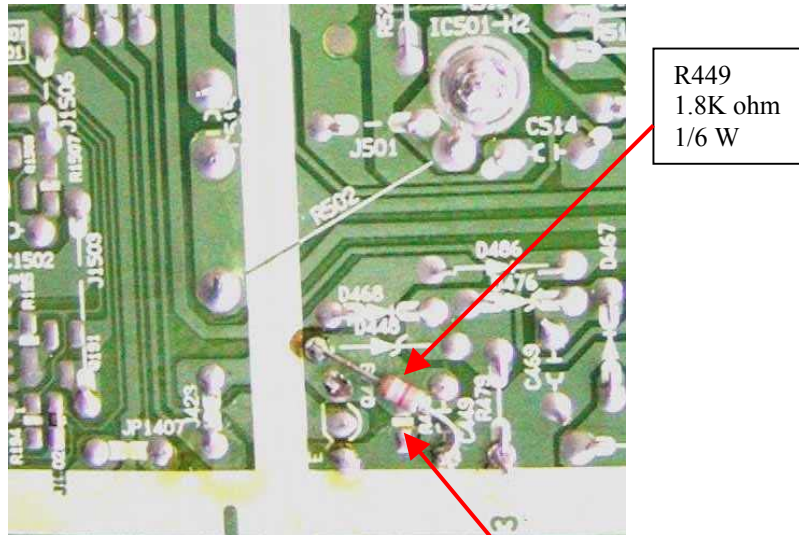


Fig. 1

Remove R449 10K
Surface Mount