



SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 65

DATE: 18/05/04

SUBJECT: CP14G1/CP21G1 EEPROM (IC802)

Fault: Volume control erratic, all or nothing, after replacing IC802.

Cause: The replacement IC (24LC08B/P) is different in initial data from the original.

Remedy: Change the Service Data of Item 82 S-STE from “1” to “0”.

Method: Enter into service mode by pressing the “Menu” button on the remote control and press the “Volume +” button on the TV set. Select Item 82 “S-STE” using the “Timer” and/or “Sound Mute” buttons on the remote control. Change the Data value from “1” to “0” using the “Volume + / -” buttons. Press the “Menu” button on the remote control to leave service mode.