

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 66

DATE: 27/05/04

SUBJECT: VHR-VK310/910 High pitched mechanism noise

Fault: There is a high pitched noise coming from cylinder assembly when mechanism running.

Cause: Head Motor Stator warped.

Remedy: Remove one (1) screw from Head Motor Stator PCB.

Method:

