

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 67

DATE: 03/08/04

SUBJECT: CP20SR1(G)/CP21SA1(G) 50Hz Buzz

Fault: 50Hz audio buzz from speakers.

Cause: Earth loop.

Remedy: Connect a heavy gauge wire between “TP-E” (near tuner) and “IC001-H2” (behind front AV inputs).

Method: See picture below.

