

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 72

DATE: 11/08/05

SUBJECT: CP29AF2V(A)/CP21AF1V(A) Hum

Fault: Audio buzz at low volume on high white content picture.

Cause: Earth loop.

Remedy:

1. Connect a heavy gauge wire between “(J)W22” (near front AV sockets) and “JW24” (near IC001).
2. Connect a heavy gauge wire between negative pin of C854 and the heat sink of IC001.

