

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 75 DATE: 12/07/06

SUBJECT: CP29FS2 HUM AT LOW VOLUME

Fault:

50Hz audio buzz (hum) at low volume.

Cause:

Audio decoder circuit inadequate supply filtering.

Remedy:

Replace L203 with a 33-ohm resistor.