

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 78 DATE: 16/06/08

SUBJECT: HVR-DX625H FIRMWARE UPGRADE

Fault:

The unit becomes non-responsive at 18:00 hours, if it was in stand-by mode for more than 24 hours.

Note:

This firmware upgrade may fix other irregular behaviour of this model, like jittery videotape playback.

Cause:

Firmware bugs.

Remedy:

Please apply the DAEWOO F/W UPGRADE CD part number: **HVRDX625HUPGRADE**.

The disc comes with the following instructions:

1. Power the unit on.
2. Open the disc tray.
3. Put the F/W upgrade disc in the tray.
4. Close the tray.
5. Press the [ENTER] button after the upgrade file is auto detected.
6. Remove the disc when the upgrade is finished. (CAUTION: During upgrade do not turn the unit off!)
7. Pull out the AC power plug.
8. Put back the AC power plug.
9. Power on again.
10. Press the [SETUP] button on the remote control.
11. Move cursor to "System" menu.
12. Select "System Info".
13. Check F/W version: FD304*004*U080103.
14. Select "Restore Defaults" and press [ENTER].