

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 81 DATE: 10/09/09

SUBJECT: EMC7586V Under Cooking in Convection Mode

Fault:

Not reaching programmed convection temperature.

Cause:


Temperature sensor PN: MM51401000008 is not the correct type and too much ventilation of oven cavity.

Remedy:


Replace Temperature sensor and PET film PN: EMC7586VMOD.

Method:

- Remove cabinet cover.
- Replace Temperature sensor.
- Remove original PET film

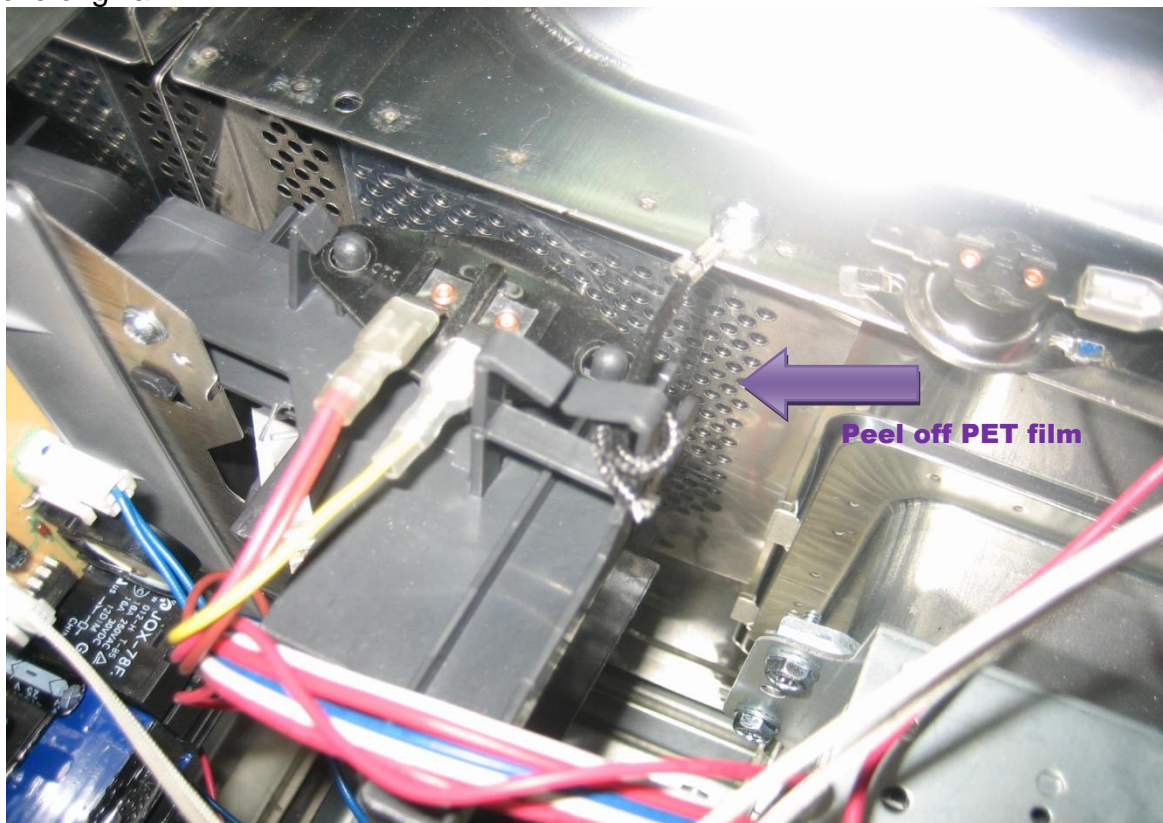

- Insert new PET film

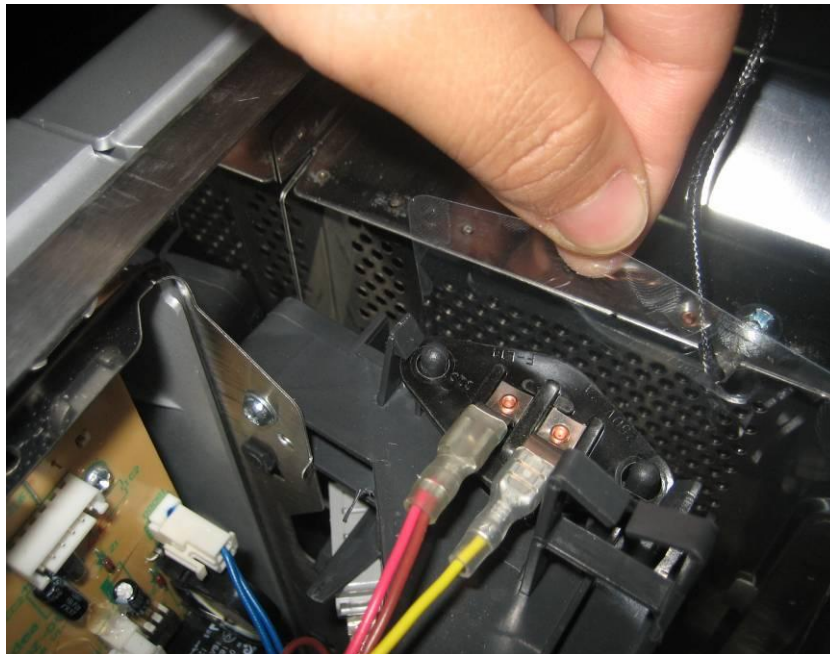

- Make sure that only the red area is covered and leave blue free.

