

SANYO

SANYO Australia Pty Ltd

CONSUMER ELECTRONICS DIVISION

TECHNICAL BULLETIN No. 82 DATE: 3/11/09

SUBJECT: LCD32K30TD & LCD42K30TD High pitch noise in stand-by

Fault:

The TV emits a high pitch noise when in stand-by mode.

Cause:

C1610 capacitor on the power supply PCB resonates.

Remedy:

Replace C1610 / 0.001uF 1KV capacitor with a non resonating type. Part number: 3032621809

Method:

Locate and replace C1610 capacitor on power supply PCB.

