



Notice

- | | |
|---|--|
| <input type="checkbox"/> CORRECTION | <input type="checkbox"/> PRODUCTION CHANGE |
| <input checked="" type="checkbox"/> SERVICE FLASH | <input type="checkbox"/> ADD INFORMATION |

FILE NO.

REVISION-7

Please add this notice to the Service Manual listed below.

Category : <u>Multi-media Projector</u>	Issued Date : <u>May / 2009</u>
Model : <u>PLC-XF35NL</u> <u>PLCXF35N</u> <u>PLC-XF35</u>	Effective from : <u>Chassis No. MY8-XF3503</u>
Destination : <u>U.S.A.,Canada,</u> <u>Europe,Asia,Africa</u>	REF. NO. : <u>SM5110413</u>
	MY8-XF35NL03 MY8-XF35N03

NOTE: Match the Chassis No. on the cabinet top with the Chassis No. in the Service Manual. **If the Chassis No. does not match the unit's**, additional Service Literature is required. Only the Difference Service Information is given in this manual. For detail Service Information, Refer to the Original Service Manual SM5110413-00, issued in November 2002, for Model PLC-XF35 / PLC-XF35N / PLC-XF35NL.

Service Flash :
This service flash concerns the model replaced with new LCD Panel (LCX082BLF) by service. (Chassis No. is changed to MY8-XF3503, XF35N03, XF35NL03.)

Outlines:
Difference with other chassis No.

1. Main board (Part Location No. [A801]
Software change (IC871) and resistance 3 pieces deletion. (R7511, R7541, R7571)
2. LCD Panel/Prism assembly (Part Location No. [128]
LCD Panel and Optical filter(WV)

FILE WITH ORIGINAL SERVICE MANUAL (SM5110413)

PRODUCT CODE
1 122 154 52 (MY8AR)
1 122 154 72 (MY8AS)
1 122 154 92 (MY8AT)

REFERENCE NO. SM5110413-07

Before Parts Replacement

1. Chassis No. Check


Please check the type of LCD Panel.

Check the printed chassis number on the Rating Label.

This service flash is effective for the chassis number "MY8-XF3503, MY8-XF35N03, MY8-XF35NL03".

Two chassis No. is displayed.

The projector in which chassis No. of **MY8-XF3503, XF35NL03, XF35N03** is not displayed is off the subject of this notice.

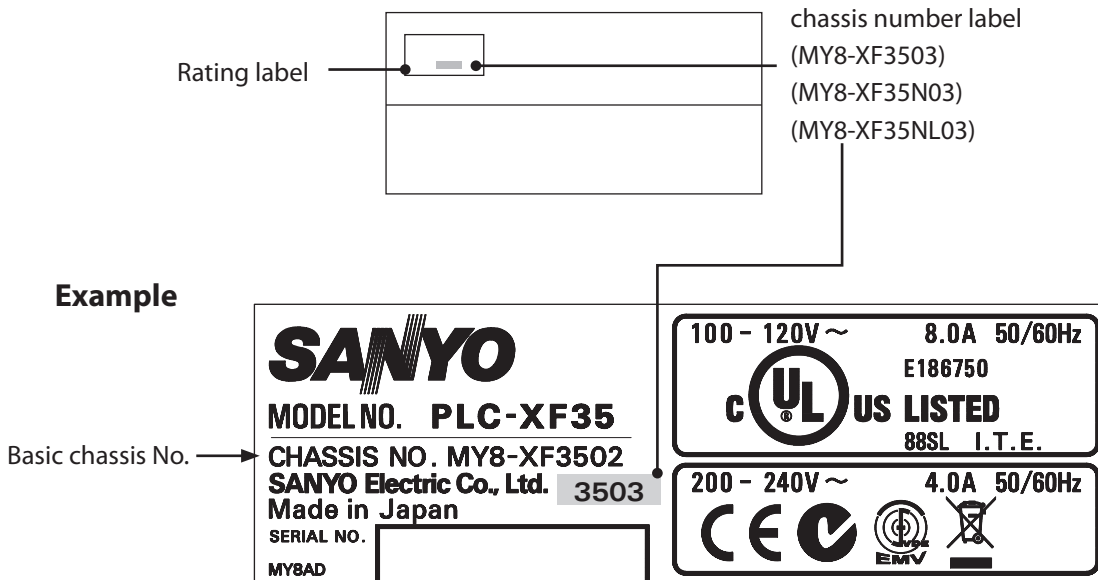


2. Panel Type Check

Please check the type of LCD Panel.

Check the printed number on the flat cable of the LCD Panel.

This service flash is effective for the type "BLF".

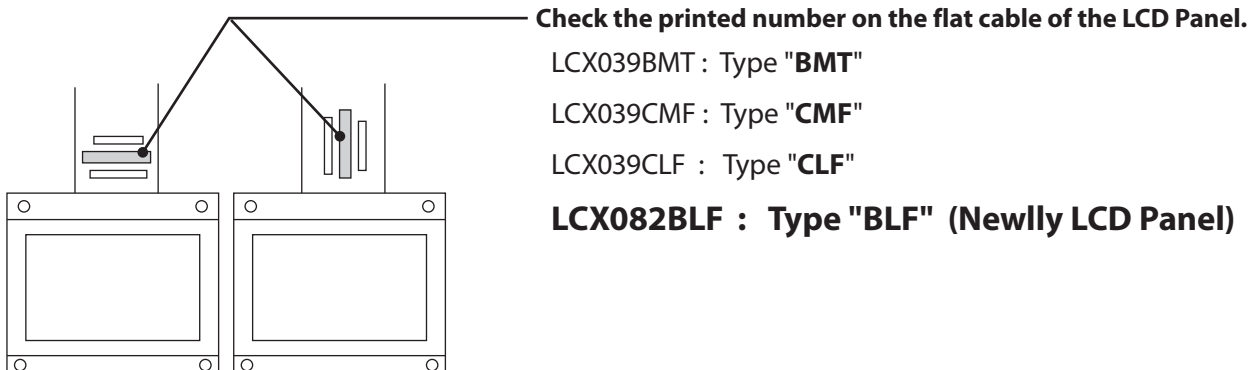

Chassis No. MY8-XF3503, MY8-XF35N03, MY8-XF35NL03

Difference of Chassis No. MY8-XF3500/XF35N00/XF35NL00

No. MY8-XF3501/XF35N01/XF35NL01

No. MY8-XF3502/XF35N02/XF35NL02

Key No.	Part No.	Description	Q'ty
Assembled Board			
A801	610 346 4121	ASSY,PWB MAIN MY8AR	1
IC871	410 692 2105	IC MBM29LV160BE-90-0616A-	1
R7511	N/A	N/A	-
R7541	N/A	N/A	-
R7571	N/A	N/A	-
Optical Parts			
128	610 346 4282	ASSY,PNL/PSM-MY8AR	1
128-OF-R	645 101 0223	OPTICAL FILTER(WV85/WV4)GR	1
128-OF-G	645 101 0223	OPTICAL FILTER(WV6/WV4)B	1
128-OF-B	645 101 0230	POLARIZED GLASS(HOUT/QU)	1
128-PG-R	945 054 0395	POLARIZED GLASS(OUT/R)	1
128-PG-G	945 054 0401	POLARIZED GLASS(OUT/G)	1
128-PG-B	945 054 0418	POLARIZED GLASS(OUT/B)	1
EL901R	645 101 0193	LCD(LCXX082BLF-7 R)	1
EL901G	645 101 0209	LCD(LCXX082BLF-8 G)	1
EL901B	645 101 0216	LCD(LCXX082BLF-6 B)	1
Service Tool (Software)			
	610 346 5159	CD-ROM,PJ XF45,35 V520	1

Order parts other than the Main board and the ASSY PNL/PSM with the service manual of the basic chassis No. displayed in the ratings label.

ASSY, PNL/PSM

